


# Adjustable Run Tee

Carbon Steel ... SBART  
Stainless Steel ... SSART

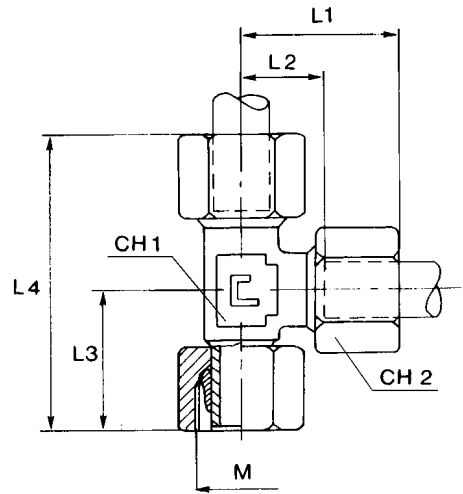

Series	Pressure	Tube								Item Number Carbon Steel	Item Number Stainless Steel
		OD	M	L1	L2	L3	L4	CH1	CH2		
L Light	PN 315	6	M12 x 1.5	27	12	26	53	12	14	SBART-06L	SSART-06L
		8	M14 x 1.5	29	14	27.5	56	12	17	SBART-08L	SSART-08L
		10	M16 x 1.5	30	15	29	59	14	19	SBART-10L	SSART-10L
		12	M18 x 1.5	32	17	29.5	62	17	22	SBART-12L	SSART-12L
		15	M22 x 1.5	36	21	32.5	69	19	27	SBART-15L	SSART-15L
		18	M26 x 1.5	40	23.5	35.5	75	24	32	SBART-18L	SSART-18L
	PN 160	22	M30 x 2	44	27.5	38.5	83	27	36	SBART-22L	SSART-22L
		28	M36 x 2	47	30.5	41.5	91	36	41	SBART-28L	SSART-28L
		35	M45 x 2	56	34.5	51	111	41	50	SBART-35L	SSART-35L
		42	M52 x 2	63	40	56	123	50	60	SBART-42L	SSART-42L
S Heavy	PN 400	6	M14 x 1.5	31	16	27	58	12	17	SBART-06S	SSART-06S
		8	M16 x 1.5	32	17	27.5	61	14	19	SBART-08S	SSART-08S
		10	M18 x 1.5	34	17.5	30	66	17	22	SBART-10S	SSART-10S
		12	M20 x 1.5	38	21.5	31	71	17	24	SBART-12S	SSART-12S
		14	M22 x 1.5	40	22	35	75	19	27	SBART-14S	SSART-14S
	PN 630	16	M24 x 1.5	43	24.5	36.5	79	24	30	SBART-16S	SSART-16S
		20	M30 x 2	48	26.5	44.5	96	27	36	SBART-20S	SSART-20S
		25	M36 x 2	54	30	50	105	36	46	SBART-25S	SSART-25S
		30	M42 x 2	62	35.5	55	119	41	50	SBART-30S	SSART-30S
	PN 315	38	M52 x 2	72	41	63	138	50	60	SBART-38S	SSART-38S